



# Razer Blade RZ09-0130 2015 Trackpad Button Replacement

This procedure is necessary because trackpad...

Written By: Carson Kellerman



## INTRODUCTION

This procedure is necessary because trackpad functionality is a core feature to any laptop. It should be noted that the root causes for trackpad problems within the Razer Blade RZ09-0130 2015 laptop are typically software related, so be sure that Windows and Razer Synapse is up-to-date before attempting to open the laptop. The bulk of this replacement comes from unscrewing the back panel using a T5 Torx screwdriver. Once the back panel is off, use a Phillips #0 screwdriver to remove the two screws holding the trackpad's circuitry.

---

### TOOLS:

- [T5 Torx Screwdriver](#) (1)
  - [Phillips #1 Screwdriver](#) (1)
-

## Step 1 — Back Panel



**⚠** Be sure to power off the device before beginning.

- Use a Torx T5 screwdriver to remove the ten 3 mm screws along the edge of the back panel.


## Step 2



- Remove the back panel from the laptop by sliding it away from the hinge.
- ⓘ This device is missing the battery. Make sure to detach the battery connector before proceeding with laptop repairs.




### Step 3 — Trackpad Button

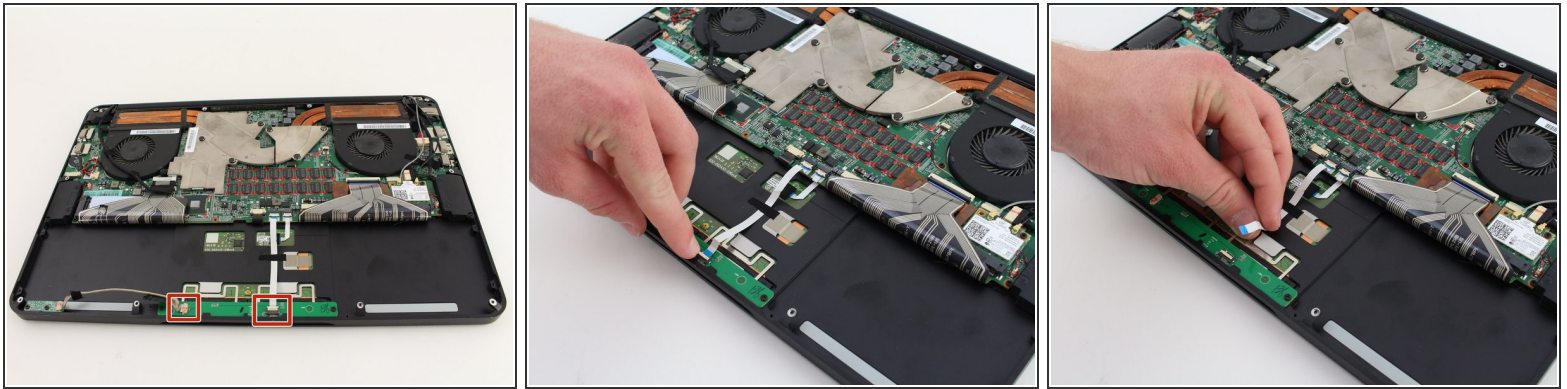


- Detach the two connectors from the motherboard by gently pulling them directly out of their ports with your fingers.

### Step 4

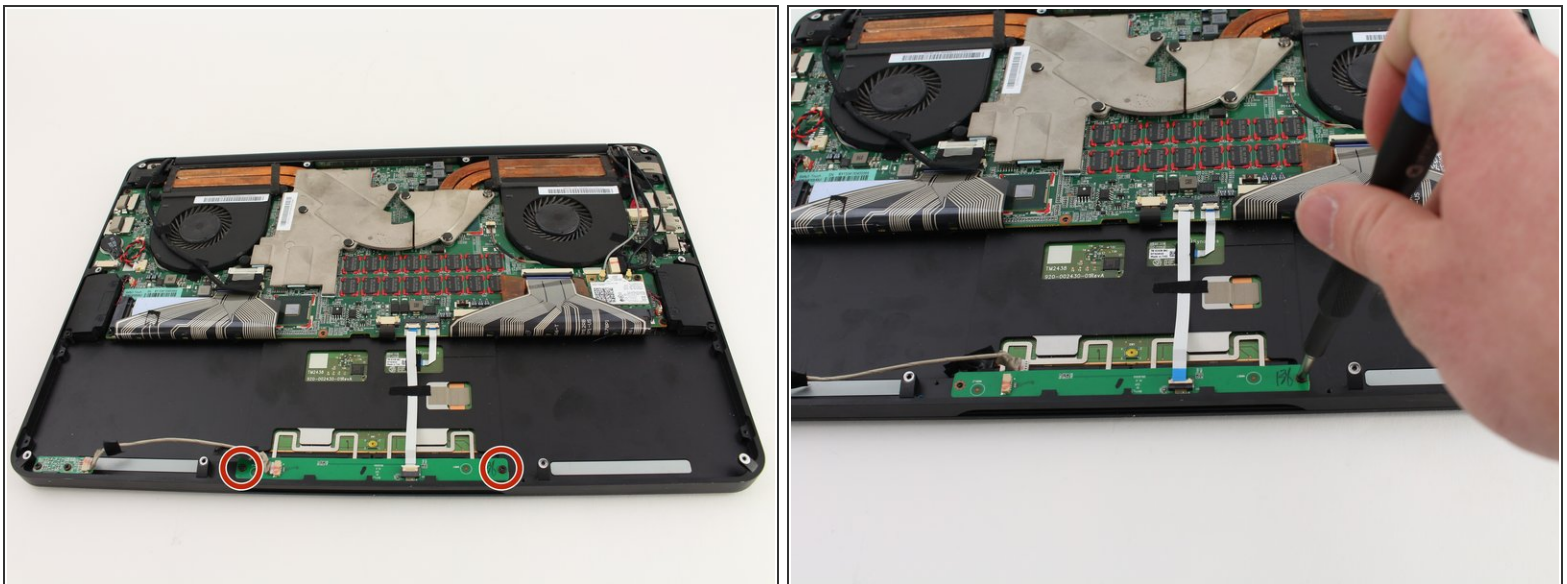

- Use a Phillips #1 screwdriver to remove the two 3 mm screws holding the trackpad's circuit board to the chassis.

## Step 5

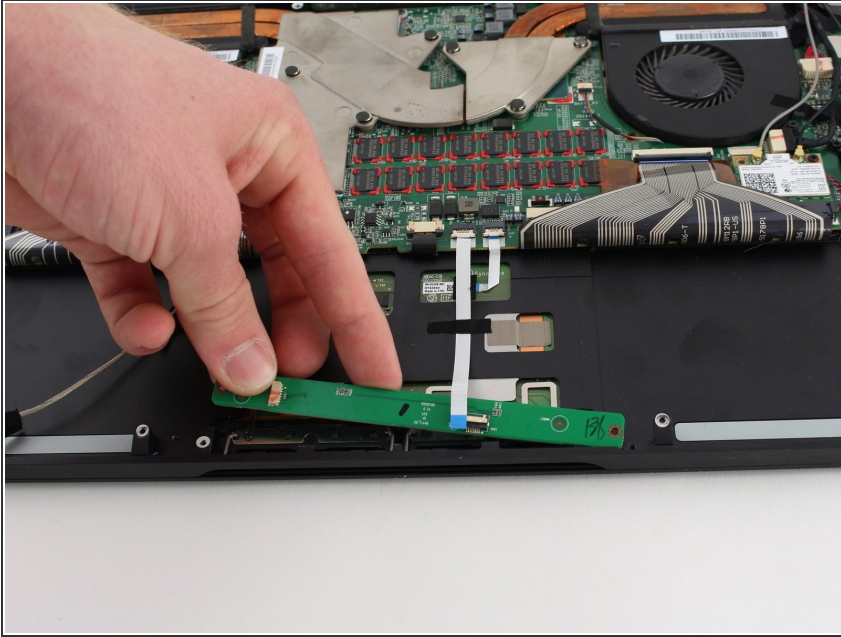

- Remove the trackpad circuit board by holding one end and gently lifting it upwards.

To reassemble your device, follow these instructions in reverse order.